


HJX2 4P AC Contactor

Standard: IEC 60947-4-1



HJX2-4P Contactor Accessories

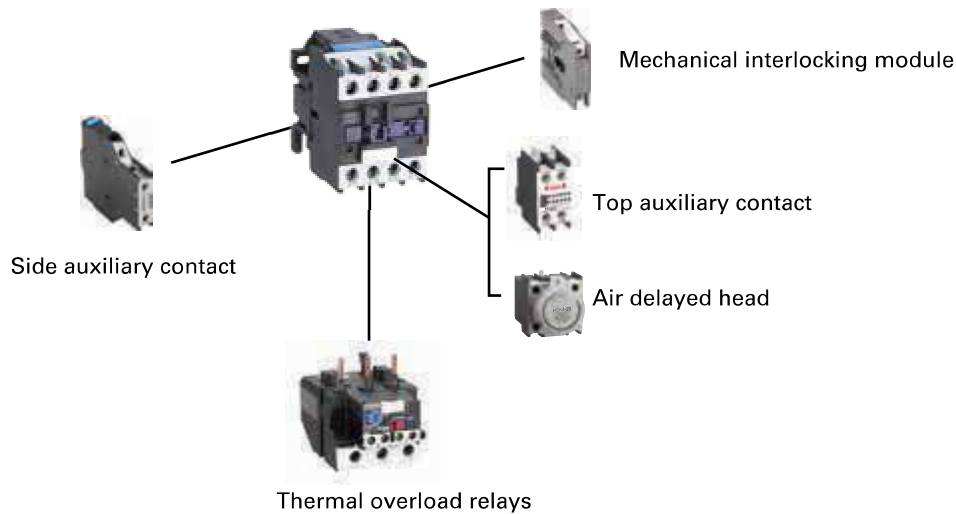

Contactor

	9	12	25	40	50	65	80	95		
Top auxiliary contact	2 Poles:HF411, HF402, HF420 4 Poles:HF404, HF413, HF422, HF431, HF440									
Side auxiliary contact	2 Poles:HFC611, HFC602, HFC620									
Air delayed head	Making time-delay: HSK420, HSK422, HSK424 Breaking time-delay: HSK430, HSK432, HSK434									
Mechanical interlocking module	9-25A: HFR632H 40-95A: HFR695HX									
Thermal overload relays	HJRS1D-25 0.1-0.16A ... 17-25A			HJRS1D-36 23-32A 30-40A			HJRS1D-93 23-32A ... 80-93A			



HJX2 4P AC Contactor

Standard: IEC 60947-4-1



Accessories

HF4 Top auxiliary contact


Pole	Contact		Wiring diagram	Reference
	NO	NC		
2P	1	1		HF411
	0	2		HF402
	2	0		HF420
4P	0	4		HF404
	1	3		HF413
	2	2		HF422
	3	1		HF431
	4	0		HF440

HSK4 Air delayed head

Delay Type	Wiring diagram	Delay Range	Reference
Making time-delay		0.1-3S	HSK420
		0.1-30S	HSK422
		10-180S	HSK424
Breaking time-delay		0.1-3S	HSK430
		0.1-30S	HSK432
		10-180S	HSK434

HFC6 Side auxiliary contact

Pole	Contact		Wiring diagram	Reference
	NO	NC		
2P	0	2		HFC602
	1	1		HFC611
	2	0		HFC620

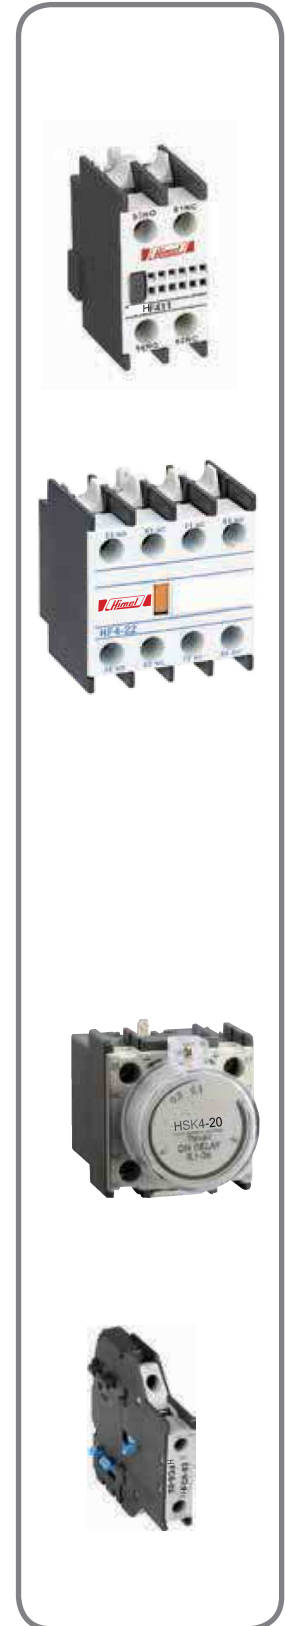

Motor Control and Protection

